Flanged High Helix Lead Screw Nuts

nut only (to suit L1349)

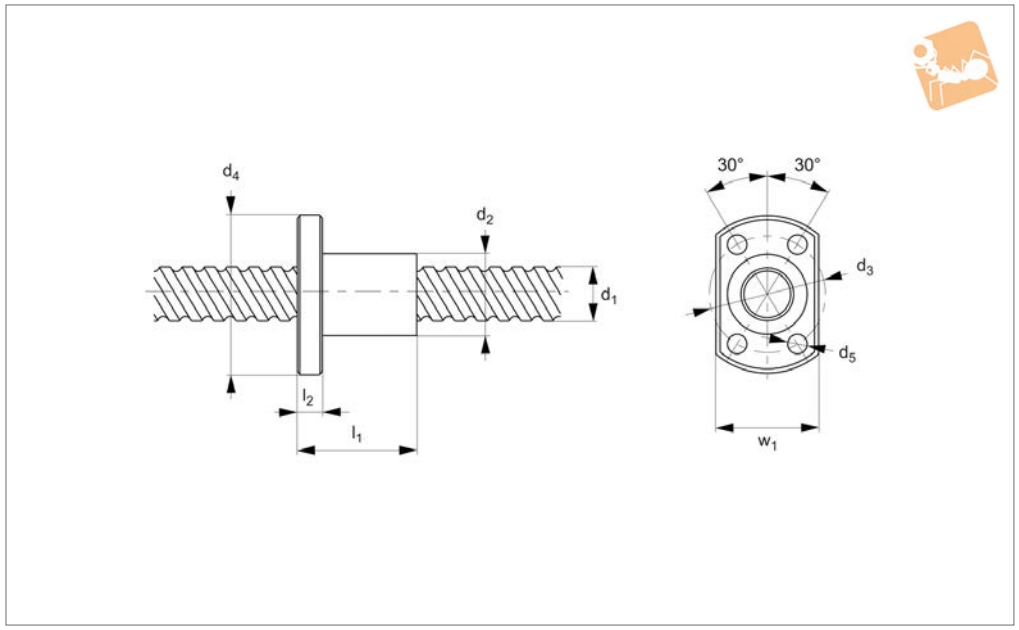

L1350

Material
Resin nut (PPS), to suit lead screw L1349.

Technical Notes
High precision.

The ‚lead' refers to the distance the nut will travel for one complete revolution of the thread.
Tight axial clearance.

Order corresponding nut - see part L1349.

Order No.	Lead	d_1 nom.	l_1	w_1	l_2	d_2	d_3 pcd	d_4	d_5	Axial clearance µm	Thrust load N max.	rpm max.	Torque screw to Nm
L1350.04-01	1	4	11.5	15	3.5	10	15	23	2.9	50	50	2000	0.25
L1350.04-02	2	4	11.5	15	3.5	10	15	23	2.9	50	60	2000	0.25
L1350.06-01	1	6	14.5	17	3.5	12	18	26	3.4	50	120	2000	0.60
L1350.06-02	2	6	14.5	17	3.5	12	18	26	3.4	50	60	2000	0.60
L1350.06-09	9	6	14.5	17	3.5	12	18	26	3.4	100	90	2000	0.60
L1350.06-18	18	6	14.5	17	3.5	12	18	26	3.4	100	70	2000	0.60
L1350.08-01	1	8	18.0	18	4.0	14	21	29	4.5	50	200	2000	0.60
L1350.08-02	2	8	18.0	18	4.0	14	21	29	4.5	50	290	2000	0.60
L1350.08-12	12	8	18.0	18	4.0	14	21	29	4.5	100	210	2000	0.60
L1350.08-24	24	8	18.0	18	4.0	14	21	29	4.5	100	210	2000	0.60
L1350.10-02	2	10	22.0	22	5.0	16	24	33	4.5	50	460	1500	0.80
L1350.10-06	6	10	22.0	22	5.0	16	24	33	4.5	100	370	1500	0.80
L1350.10-10	10	10	22.0	22	5.0	16	24	33	4.5	100	250	1500	0.80
L1350.10-15	15	10	22.0	22	5.0	16	24	33	4.5	100	410	1500	0.80
L1350.10-30	30	10	22.0	22	5.0	16	24	33	4.5	100	410	1500	0.80
L1350.12-02	2	12	25.0	25	5.0	18	26	35	4.5	50	660	1000	0.80
L1350.12-04	4	12	25.0	25	5.0	18	26	35	4.5	100	620	1000	0.80
L1350.12-08	8	12	25.0	25	5.0	18	26	35	4.5	100	820	1000	0.80
L1350.12-12	12	12	25.0	25	5.0	18	26	35	4.5	100	470	1000	0.80
L1350.12-18	18	12	25.0	25	5.0	18	26	35	4.5	100	750	1000	0.80
L1350.12-36	36	12	25.0	25	5.0	18	26	35	4.5	100	540	1000	0.80
L1350.15-05	5	15	30.0	30	6.0	24	33	42	4.5	100	890	800	0.80
L1350.15-10	10	15	30.0	30	6.0	24	33	42	4.5	100	1040	800	0.80
L1350.15-20	20	15	30.0	30	6.0	24	33	42	4.5	100	1100	800	0.80
L1350.20-10	10	20	36.0	36	7.0	30	40	50	5.5	100	1240	600	1.0
L1350.20-20	20	20	36.0	36	7.0	30	40	50	5.5	100	1420	600	1.0